

PCN Date	May 15, 2018		
Submitter's Name	Vladimir Pucek		
Submitter's Contact Details			
PCN Tracking #	PCN_C85763_TCP3500		
Description of Change	OCP issue at specified Pulse Load: freq = $500Hz$ R = 0.7140hm Vo_set = $14 - 22V$		
Reason for Change	To solve OCP issue with Rework Instruction UAR.09962: Gate Drive Transformers T203, T204 replaced by ZCT.00741.0 Ceramic Capacitor C205, C206, C222, C223 replaced by 1pc of Film Capacitor ZSK.00301 Main Labels without Safety Marks due to new Gate Drive Transformers - Safety Critical Component		
Summary of Changes Between New and Old Part	 Replace Gate Drive Transformers. Replace Ceramic Capacitor. 		
Traceability Guidelines (lot code/date code, markings, ship date)	NA		
Last Time Buy Date	NA		
Datasheet Attached Filename(s):	NA		
Qualification/Test Data Attached Filename(s):	NA		
Impact on Reliability	Non-impact on Reliability		

Closure Approvals

Company	Name	Contact Details	Date
Bel Power Solutions	Audrey Boulot Product Manager		May 15, 2018



Product impacted by this notification are as below:

TCP3500-1048S1010	3
TCP3500-1048S3680	3
TCP3500-H048G	