




## Discontinuation Notice for EVQ-9P701K Light Touch Switch


PDN.PG26.04.23.2015

04/23/15

<b>Effective Date:</b>	April 23, 2015
<b>Last Time Buy Date:</b>	June 30, 2015
<b>Last Eligible Ship Date:</b>	August 17, 2015
<b>Discontinuation Details:</b>	EVQ-9P701K shall be replaced with the improved part number EVQ-9P701P. See details on the next page for the improvement changes. EVQ-9P701K shall no longer be available for purchase after above effective date.
<b>Suggested Replacement:</b>	EVQ-9P701P
<b>Affected Part Numbers:</b>	EVQ-9P701K
<b>Datasheets:</b>	See Attached
<b>Notes:</b>	

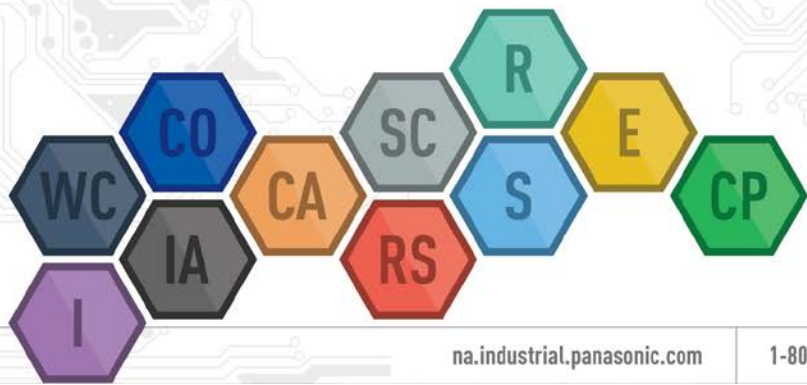


## Details

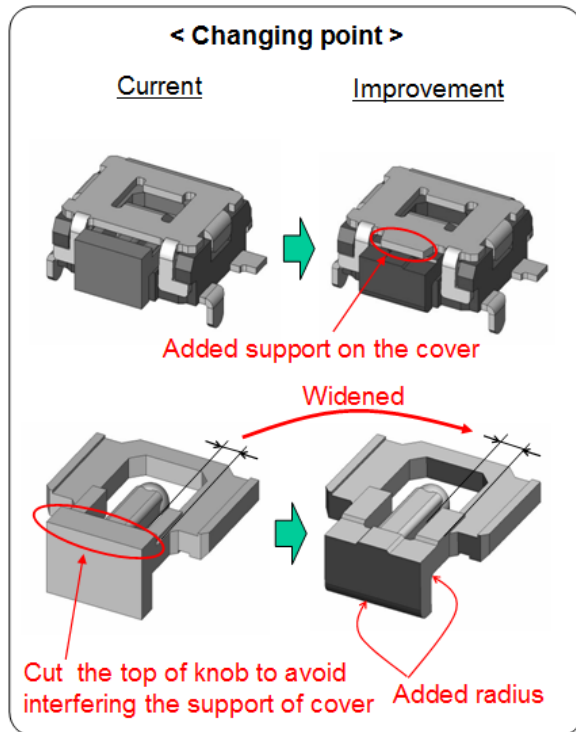

<Test method>

After the P.W.B is horizontally fixed as shown in figure 1, pressure is applied to the switch gradually by push-pull gauge and the force was measured when the push plate broke down.

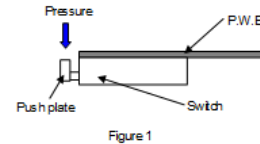

<Test result>

(Unit : N)

	Improvement	Current
1	8.6	5.1
2	9.2	5.3
3	9.6	4.7
4	9.8	4.9
5	9.4	4.5
6	9.1	4.6
7	8.8	4.8
8	8.7	5.0
9	8.9	4.6
10	9.1	4.6
Ave	9.12	4.81
max	9.8	5.3
min	8.6	4.5
$\sigma$	0.39	0.26

Push plate strength of improvement : 8.6 – 9.8 N