

MOTOR SPECIFICATIONS



DIMENSIONS

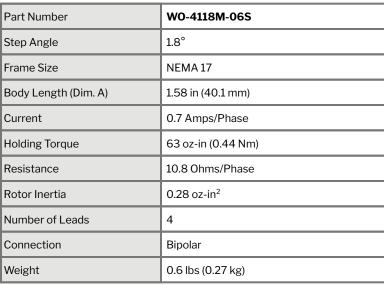

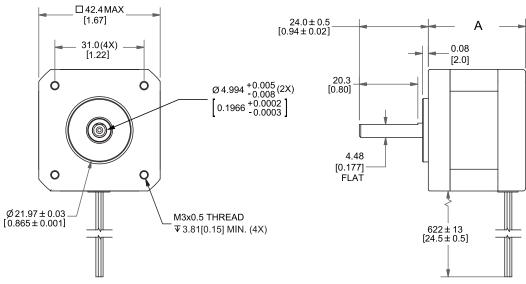

PERFORMANCE CURVE

4118M-06S 24VDC, 0.7 Amps/Phase, Bipolar, 1/2 Stepping 70 0.45 0.4 60 0.35 0.3 Torque (oz-in) 40 0.25 30 0.2 0.15 20 0.1 10 0.05 0 6 500 1500 2000 2500 3000 Speed (pps) 4 Speed (rps)

OPERATING SPECIFICATIONS

Radial Play	0.001" max @ 1 lbs load
End Play	0.003" max @ 2 lbs load
Shaft Run Out	0.002" TIR
Concentricity of Mounting Pilot to Shaft	0.003" TIR
Perpendicularity of Shaft to Mounting Face	0.003" TIR
Max Axial Load	6 lbs
Maximum Case Temperature	80 C
Ambient Temperature	-20° to 50° C
Storage Temperature	-20° to 100° C
Humidity Range	85% or less, non-condensing
Magnet Wire Insulation	Class B 130° C
Insulation Resistance	100MΩ at 500 VDC
Dielectric Strength	500 VAC for 1 minute

WIRING TABLE

COLOR	FUNCTION
Red	A+ Phase
Blue	A- Phase
Green	B + Phase
Black	B- Phase

OPERATION & USAGE TIPS



Do not disassemble motors; a significant reduction in motor performance will occur.



Do not machine shafts; this will have a negative effect on shaft run out and perpendicularity.



motor from drive while in operation.



Do not use holding torque/detent torque of motor as a fail safe brake.



Do not hold motor by lead wires.



Do not exceed the rated current; this will burn the motor

 ${\sf FAILURE\ TO\ COMPLY\ WITH\ THESE\ RECOMMENDATIONS\ WILL\ VOID\ ALL\ WARRANTY\ TERMS}$

RECOMMENDED



Microstepping Driver



Single Axis Controller + Driver **R256-RO**

Motion Control, Solved.

MOTOR ENGINEERING & MANUFACTURING







Small Batch to OEM Volume Production

